

# Work Order ID 79713

**\*79713\***

Page 1

January-31-12 4:19:00 PM

Item ID: D205-634-041

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Replacement Skidtube

Start Date: 31/01/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 16/02/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: M.L.J.

Date: 12/01/31 Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start **\*NR1\***

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D2580-041

(DEO) Rev.E

100

0.00

**\*100\***

DOCUMENT CONTROL

DC

Memo

0.00

Document Control

Photocopy D205-634 bluefile & type labels per PPP D205-634-041 CHG005

N/A *[Signature]*

110

0.00

**\*110\***

BENDING MACHINE - SKIDTUBES

CNC Bend 1

Memo

0.00

CNC Delta 100 Bender

1-Bend as per program D2580.C on CNC Bender and Folio 16

2-Cut tubes as per Dwg. D2580

3- scribe batch# in aft end of tube

SAD 12-02-15

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

**\*79713\***

Page 2

**\*N900040100\***

Setup Start **\*NS1\***

Stop \*NS2\*

**\* 1 \***

**Cust Item ID:**

**\* 1 \***

**Customer:**

**Reference:**

Run Start \*NR1\*

Date:

Stop **\*NR2\***

**Insp.**

0.00

**\*120\***

## Skidtubes

## Memo

0.00

## Skidtubes

1- Deburr ends and remove bending marks

2- Prepare tube for welding as per QSI 004

130

QC5- Inspect part completeness to step on W/O

0.00

**\*130\***

QC

## Memo

0.00

## Quality Control

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☐ No ☐ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

# Work Order ID 79713

**\*79713\***

Page 3

January-31-12 4:19:00 PM

Item ID: D205-634-041

Accept

**\*N9000040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Replacement Skidtube

Start Date: 31/01/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 16/02/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start **\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop **\*NR2\***

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

140

0.00

**\*140\***

Skidtubes

Skidtubes

Memo

0.00

1-Weld step D2576 as per Dwg. D2580 and QSI004  
A/R Aluminum Rod

2-Grind welds on step as per Dwg D2580

3- Insert D4202-1 spacer, swage as per QSI002 and trim/ grind flush per QSI002  
and dwg. Hold x-bolt with DT9701. Use tube expander 1/2 x 17G to start  
expansion and finish with 1/2 x 18G to achieve dwg dimension.

4-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64",  
adjust stopper not to hit web. Debur

6-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Debur

7-Drill pilot holes for Tow ring using DT8091, open to .640" and Debur

150

QC10- Inspect visual per QSI004- ground welds

0.00

**\*150\***

QC

Memo

0.00

Quality Control

*Handwritten notes and signatures:*  
CF 12.2.22  
120164 02/02/22  
12.02.22 1x

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

# Work Order ID 79713

**\*79713\***

Page 4

January-31-12 4:19:00 PM

Item ID: D205-634-041

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Replacement Skidtube

Start Date: 31/01/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 16/02/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start **\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop **\*NR2\***

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

160

QC5- Inspect part completeness to step on W/O

0.00

**\*160\***

QC

Memo

0.00

Quality Control

12 - 12 - 22 ①

170

Pressure Wash per QSI005 4.3

0.00

**\*170\***

HandFinish

Memo

0.00

Hand Finishing

Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch and leave fwd cap out of solution.

1 M-4/OP Feb 23/2012.

180

White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum

0.00

**\*180\***

Powdercoat

Memo

0.00

Powder Coating

START TIME:  
OVEN TEMPERATURE:  
FINISH TIME:

4:15  
320°F  
4:45

1 X M-4/OP 12/22/27

M 120222

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



# Work Order ID 79713

**\*79713\***

Page 5

January-31-12 4:19:00 PM

Item ID: D205-634-041 Accept **\*N900040100\*** Setup Start **\*NS1\***  
 Revision ID: Stop **\*NS2\***  
 Item Name: Replacement Skidtube  
 Start Date: 31/01/2012 Start Qty: 1.00 **\*1\*** Cust Item ID:  
 Required Date: 16/02/2012 Req'd Qty: 1.00 **\*1\*** Customer:  
 Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start **\*NR1\***  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
190	QC3- Inspect Part Finish	0.00							
<b>*190*</b>									
QC	Memo	0.00							
Quality Control									

1 0 12/02/29

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 79713****\*79713\***

Page 6

January-31-12 4:19:00 PM

Item ID: D205-634-041

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Replacement Skidtube

Start Date: 31/01/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 16/02/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start **\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

200

0.00

**\*200\***

HandFinish

Hand Finishing

**Memo**

0.00

1-Install inserts &amp; wearplates &amp; Gaskets as per Dwg. D2580. Use a drop of

Sikaflex on insert holes before installing wearplates

A/R Sikaflex-291 11/19/08

Sikaflex expire date: 12/09

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step &amp; Aft Cap with

Sikaflex. Clean excess adhesive

A/R Sikaflex-291 11/19/08

Sikaflex expire date: 12/09

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch: 11120125

1 0 11 12/03/01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Work Order ID 79713

**\*79713\***

Page 7

January-31-12 4:19:00 PM

Item ID: D205-634-041

Accept

**\*N900040100\***

Setup Start

**\*NS1\***

Revision ID:

Item Name: Replacement Skidtube

Stop

**\*NS2\***

Start Date: 31/01/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 16/02/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

**\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop

**\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210	QC5- Inspect part completeness to step on W/O	0.00							
<b>*210*</b>									
QC	Memo	0.00							
Quality Control	Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024								
220		0.00							
<b>*220*</b>	Packaging								
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPPD205-634-041								
	Location: _____								
	PPP Rev: _____								
230	QC21- Final Inspection - Work Order Release	0.00							
<b>*230*</b>									
QC	Memo	0.00							
Quality Control									

8 12/03/04

12/03/12

12/3/19  
mf  
12-03-20

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

# Picklist Print

January-31-12 4:19:05 PM

Page 1

Work Order ID: 79713

\*79713\*

Parent Item: D205-634-041

\*D205-634-041\*

Parent Item Name: Replacement Skidtube

Start Date: 31/01/2012

Required Date: 16/02/2012

Start Qty: 1.00

Required Qty: 1.00

## Comments:

IPP Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30  
 KJ IPP Rev P 10.02.19  
 per PAR09-043 EC verified by:DD  
 IPP Rev: O 06.02.28 Added paperwork EC  
 IPP Rev:P 07-07-09 SS Wearplates & Gaskets JLM IPP Rev:Q  
 10.12.01 as per chg003 DD verf:EC IPP REV:R 12.01.23 AS  
 PER ECN11-684 VERF:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D4202-1 *D4202-1* Spacer		Manufactured	No			140	Each	960.0000	20	20			
									**				

Location	Loc Qty	Loc Code
LG	446	
77727	123	
77729	323	
LG002	514	
78806	514	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



# Picklist Print

January-31-12 4:19:05 PM

Page 2

Work Order ID: 79713

**\*79713\***

Parent Item: D205-634-041

**\*D205-634-041\***

Parent Item Name: Replacement Skidtube

Start Date: 31/01/2012

Required Date: 16/02/2012

Start Qty: 1.00

Required Qty: 1.00

D2580-1

Manufactured No

110

Each

20.0000

1

1

**\*D2580-1\***

205 Skidtube bent detail

\*\*

SAD 12-02-15

Location

Loc Qty

Loc Code

LG

17

76570

2

77679

2

78240

2

78241

1

78531

2

79281

2

79282

2

79389

2

79390

2

ST

1

78701

1

ST046

2

78702

2

B80124

①

D2576-3

Manufactured No

140

Each

76.0000

1

1

**\*D2576-3\***

Step (machining detail)

\*\*

BE 12/02/22

Location

Loc Qty

Loc Code

LG

76

70883

26

74136

50

1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

# Picklist Print

January-31-12 4:19:05 PM

Page 3

Work Order ID: 79713

\*79713\*

Parent Item: D205-634-041

\*D205-634-041\*

Parent Item Name: Replacement Skidtube

Start Date: 31/01/2012

Required Date: 16/02/2012

Start Qty: 1.00

Required Qty: 1.00

D2855

Manufactured

No

200

Each

78.0000

1

1

\*D2855\*

Cap

\*\*

12/02/29

## Location

## Loc Qty

## Loc Code

FP002

78

65519

2

73347

30

75074

46

AN3-5A

Purchased

No

200

Each

1,250.000

2

2

\*AN3-5A\*

Bolt

\*\*

12/02/29

## Location

## Loc Qty

## Loc Code

ST350

1250

115371

46

117423

206

118626

298

119355

200

120187

500

AN960JD10L

NAS1149D0332J

Purchased

No

200

Each

0.0000

2

2

\*AN960JD10L \*

Washer

\*\*

1119042(V2) 12/02/29

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

# Picklist Print

January-31-12 4:19:05 PM

Page 4

Work Order ID: 79713

**\*79713\***

Parent Item: D205-634-041

**\*D205-634-041\***

Parent Item Name: Replacement Skidtube

Start Date: 31/01/2012

Required Date: 16/02/2012

Start Qty: 1.00

Required Qty: 1.00

ALS7-1032-130

Purchased

No

200

Each

2,472.000

50

50

**\*AIS7-1032-130\***

Insert AWS-4-1032-130

\*\*

11/02/29

## Location

## Loc Qty

## Loc Code

ST280

328

117717

27

118966

22

119775

279

ST281

71

119794

71

ST282

2073

119530

73

120181

2000

11120410

x25

11120671

x25

AN3C4A

Purchased

No

200

Each

3,149.000

50

50

**\*AN3C4A\***

BOLT

\*\*

11/20/21 (x50) 11/02/29

## Location

## Loc Qty

## Loc Code

ST350

3149

117313

2

117688

5

117872

10

118112

16

118451

2

118838

4

119749

610

120187

2000

120423

500

AN960C10L

NAS1149C0332  
R

Purchased

No

200

Each

0.0000

50

50

**\*AN960C10I \***

washer

\*\*

11/20/21 (x50) 11/02/29

January-31-12 4:19:05 PM

Shop Packet Print

Page 4

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

# Picklist Print

January-31-12 4:19:05 PM

Page 5

Work Order ID: 79713

**\*79713\***

Parent Item: D205-634-041

**\*D205-634-041\***

Parent Item Name: Replacement Skidtube

Start Date: 31/01/2012

Required Date: 16/02/2012

Start Qty: 1.00

Required Qty: 1.00

D3566-13

Manufactured No

200 Each

58.0000 1 1

**\*D3566-13\***

Gasket

\*\*

ML 12/02/29

Location

Loc Qty

Loc Code

FP002

58

76947

58

D3566-5

Manufactured No

200 Each

33.0000 1 1

**\*D3566-5\***

Gasket

\*\*

ML 12/02/29

Location

Loc Qty

Loc Code

FP002

33

76945

33

D3566-1

Manufactured No

200 Each

34.0000 2 2

**\*D3566-1\***

Gasket

\*\*

B78808 (x2) ML 12/02/29

Location

Loc Qty

Loc Code

FP002

34

68924

2

76942

8

77569

24

D3564-11

Manufactured No

200 Each

15.0000 1 1

**\*D3564-11\***

Wearshoe

\*\*

B77056 (x1) ML 12/02/29

Location

Loc Qty

Loc Code

FP

11

76268

11

FP001

4

77614

4

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



# Picklist Print

Page 6

January-31-12 4:19:05 PM

Work Order ID: 79713

**\*79713\***

Parent Item: D205-634-041

**\*D205-634-041\***

Parent Item Name: Replacement Skidtube

Start Date: 31/01/2012

Required Date: 16/02/2012

Start Qty: 1.00

Required Qty: 1.00

D3564-13

Manufactured No

200 Each

45.0000 1 1

**\*D3564-13\***

Wearshoe

\*\*

*HL 12/02/12*

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
FP001	24	
71594	1	
75045	8	
77610	15	
FP002	21	
<u>76946</u>	21	

D3564-9

Manufactured No

200 Each

17.0000 1 1

**\*D3564-9\***

Wearshoe

\*\*

*B76950 (X1) HL 12/02/12*

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
FP001	17	
67590	4	
69943	1	
77613	12	

D3564-5

Manufactured No

200 Each

44.0000 1 1

**\*D3564-5\***

Wearshoe

\*\*

*HL 12/02/12*

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
FG	2	
34806	2	
FP001	42	
73330	1	
76269	14	
<u>76944</u>	15	
77609	12	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

January-31-12 4:19:05 PM

Page 7

Work Order ID: 79713

**\*79713\***

Parent Item: D205-634-041

**\*D205-634-041\***

Parent Item Name: Replacement Skidtube

Start Date: 31/01/2012

Required Date: 16/02/2012

Start Qty: 1.00

Required Qty: 1.00

D2594-3 Manufactured No

200 Each

1,264.000 16 16

**\*D2594-3\***

O-Ring, 205 Skidtube

\*\*

B79755(x16) MU 12/02/12

Location

Loc Qty

Loc Code

FP001

1264

65518

41

73490

223

79496

1000

D2594-1 Manufactured No

200 Each

530.0000 16 16

**\*D2594-1\***

Plug, 205 Skidtube

\*\*

MU 12/02/12

Location

Loc Qty

Loc Code

FP001

530

73401

30

74442

34

74869

184

76075

32

77035

250

V16

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

LIST OF MATERIALS					
ITEM	QTY -041	QTY -045	QTY -047	PART NUMBER	DESCRIPTION
1	X			D2580-041	SKIDTUBE ASSEMBLY
2		X		D2580-045	SKIDTUBE ASSEMBLY
3			X	D2580-047	SKIDTUBE ASSEMBLY
4	1	1	1	D2500-1-190	EXTRUSION
5			16	D2570	BUSHING
6	1	1	1	D2576-3	STEP
7	20	24	25	D2579	SPACER
8	16	16	8	D2594-1	PLUG
9	16	16	8	D2594-3	O-RING
10	1	1	1	D2596	205 WEB
11	1	1	1	D2855	AFT CAP
12	1	1		D3564-5	WEARSHOE
13	1	1		D3564-9	WEARSHOE
14	1	1		D3564-11	WEARSHOE
15	1	1		D3564-13	WEARSHOE
16	2	2		D3566-1	GASKET
17	1	1		D3566-5	GASKET
18	1	1		D3566-13	GASKET
19			1	D4406-041	WEARPLATE ASSEMBLY
20			1	D4406-043	WEARPLATE ASSEMBLY
21	50	50		ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
22	50	50		AN3C4A	BOLT
23	2	2	2	AN3-5A	BOLT
24			8	AN4-45A	BOLT
25	50	50		NAS1149C0332R	WASHER (AN960C10L)
26	2	2	2	NAS1149D0332J	WASHER (AN960JD10L)
27			8	MS21042-4	NUT (OR MS21042L4)

# GENERAL NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB  
POWDER COAT ASSEMBLY (-041/-047) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3  
POWDER COAT ASSEMBLY (-045) GREEN SANDEX (REF 4.3.5.8) PER DART QSI 005 4.3  
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D2580-041 = 34.5 lbs  
D2580-045 = 34.5 lbs  
D2580-047 = 37.7 lbs
- 8) WELDING PER DART QSI 004.
- 9) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 10) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 11) USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241/-291.
- 12) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047)
- 13) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

DEO ATTACHED

RELEASED

2011-08-29

SUBJECT

WITHDRAWN

WORK ORDER NO. 79713465  
12/01/31

E	ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-8); INCLUDED DEO D2580-D-1; REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS TD2577-205 (ZN C4-1)	RF	11.06.21
D	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/ 9183	PH	07.04.05
C	REDRAWN, INCLUDED DEO 9094/ 9097	CP	98.08.26
B	AS MANUFACTURED	DS	96.12.02
A	NEW ISSUE	DS	96.09.16
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN	RF		
CHECKED	RF		
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	11.06.21		

DART AEROSPACE LTD  
HAWKESBURY, ONTARIO, CANADA

DRAWING NO. D2580  
REV. E  
SHEET 1 OF 8  
TITLE 205 SKIDTUBE ASSEMBLY  
SCALE NTS

COPYRIGHT © 1996 BY DART AEROSPACE LTD  
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AT PRODUCE LTD.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_



NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

79713

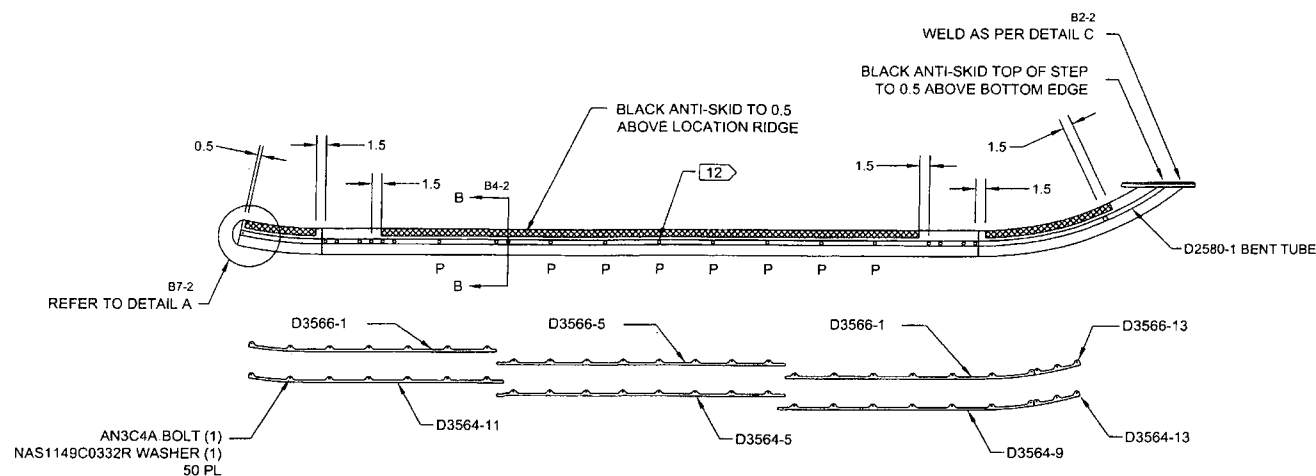


D2580-041 ASSEMBLY DETAIL

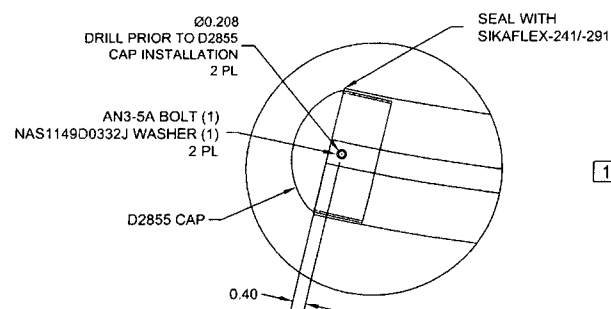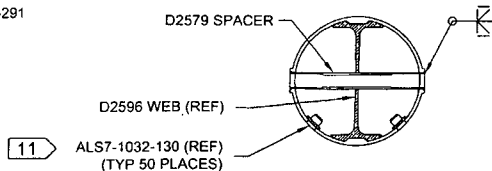DETAIL A C7-2  
SCALE 5XSECTION B-B D5-2  
SCALE 5X

AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

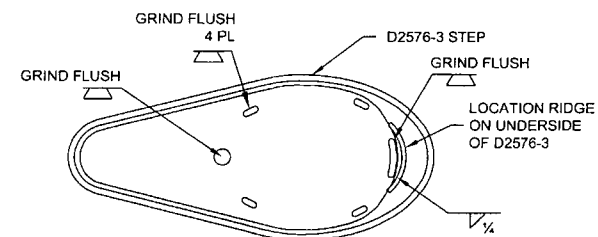DETAIL C D3-2  
SCALE 5X

DESIGN	4	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	10	DRAWING NO.	REV. E
MFG. APPR.	15	D2580	SHEET 2 OF 8
APPROVED	10	TITLE	SCALE
DE APPR.	10	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	

DEO ATTACHED

RELEASED  
2011-08-29

# Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_


Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



79713

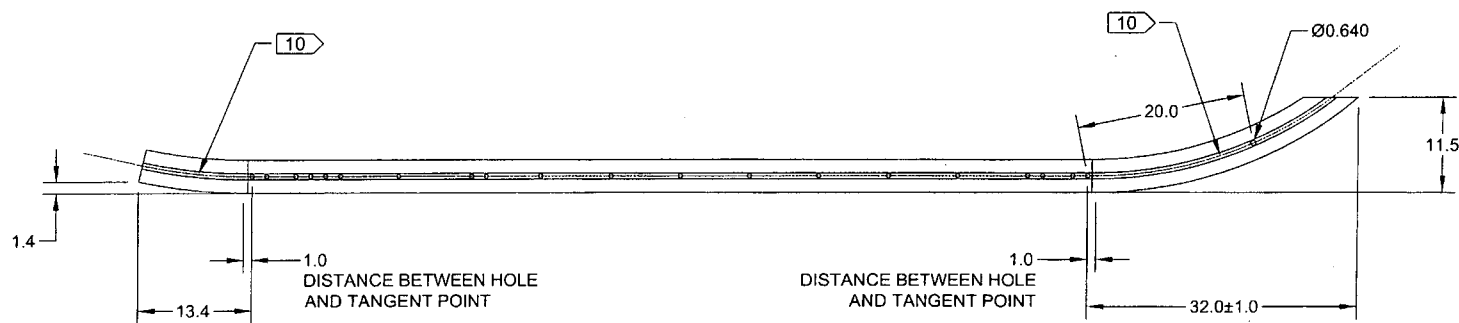

D2580-1 BENT TUBE  
(MAKE FROM D2580-101 TUBE)

DEO ATTACHED

RELEASED  
2011-08-28  
JW

DESIGN	<i>RF</i>	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>RF</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>RF</i>	D2580	SHEET 3 OF 8
APPROVED	<i>RF</i>	TITLE	SCALE
DE APPR.	<i>RF</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	COPYRIGHT © 1996 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

# Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries


79713

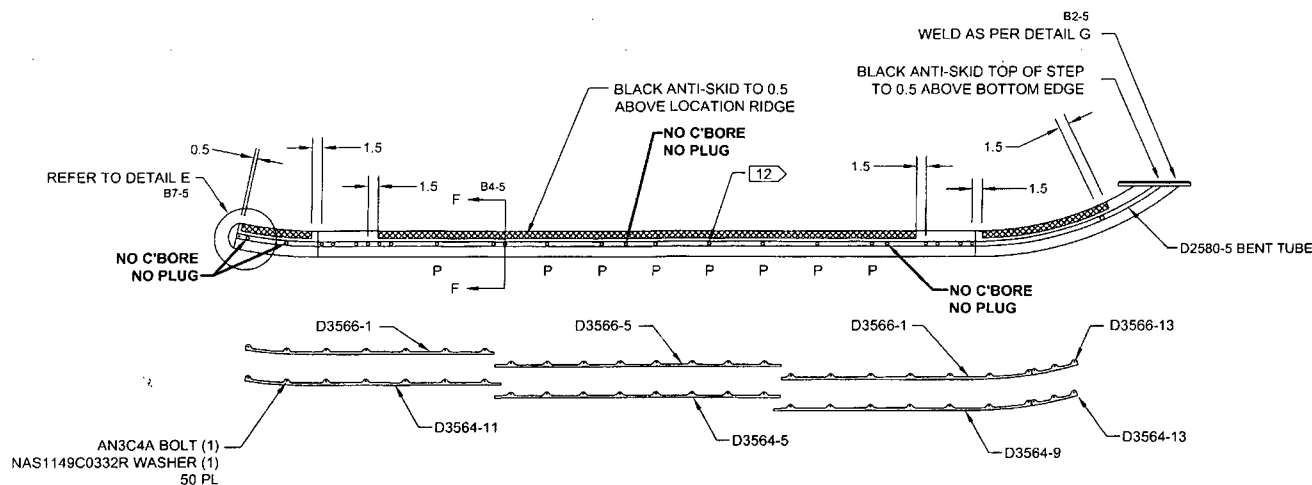

D2580-045 ASSEMBLY DETAIL

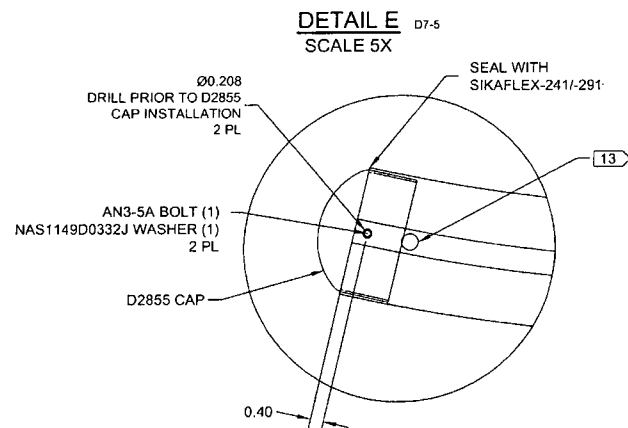


DETAIL E  
SCALE 5X

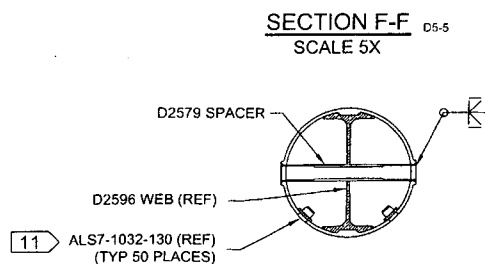

SECTION F-F  
SCALE 5X

AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (24 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

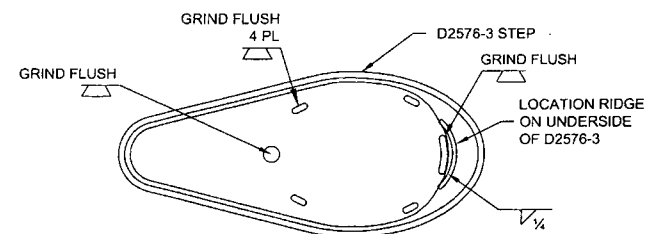

DETAIL G  
SCALE 5X

DEO ATTACHED  
RELEASED  
2011-08-29  
ANT

DESIGN	#	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	AP	DRAWING NO.	REV. E
MFG. APPR.	AP	D2580	SHEET 4 OF 8
APPROVED	AP	TITLE	SCALE
DE APPR.	AP	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

79713

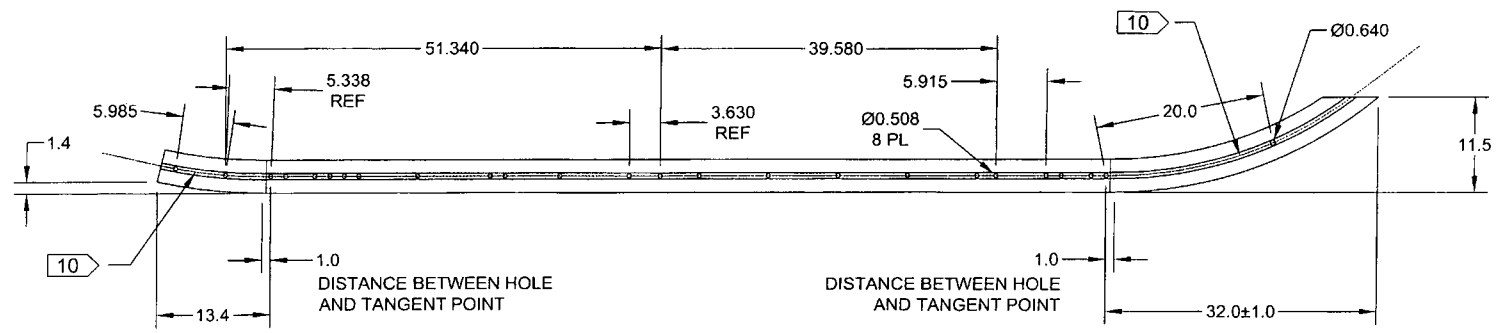

D2580-5 BENT TUBE  
(MAKE FROM D2580-101 TUBE)

DEO ATTACHED  
RELEASED  
2011-08-29

DESIGN	#	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	10	DRAWING NO.	REV. E
MFG. APPR.	10	D2580	SHEET 5 OF 8
APPROVED	10	TITLE	SCALE
DE APPR.	#	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

79713

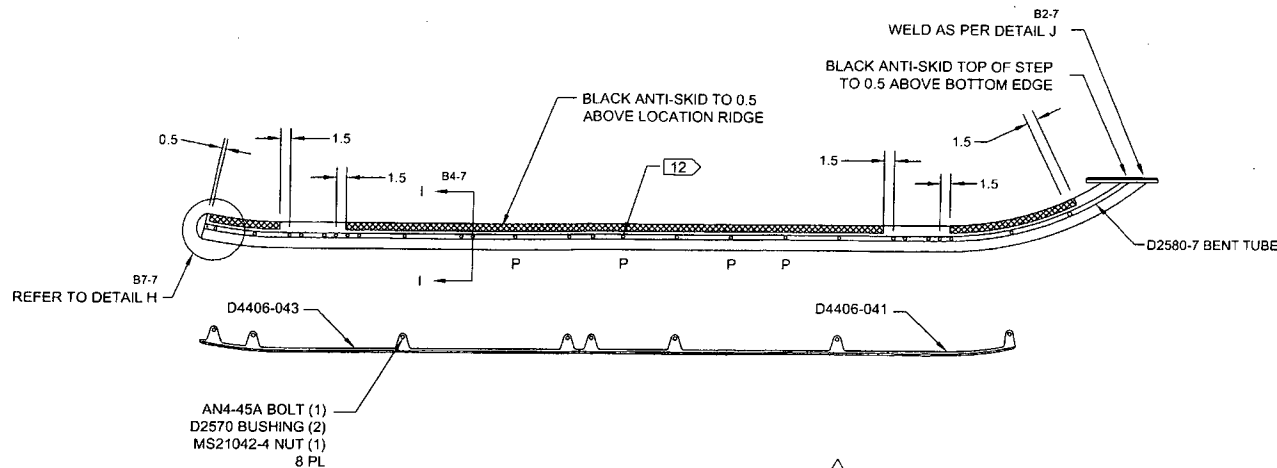


D2580-047 ASSEMBLY DETAIL E

DETAIL H SCALE 5X

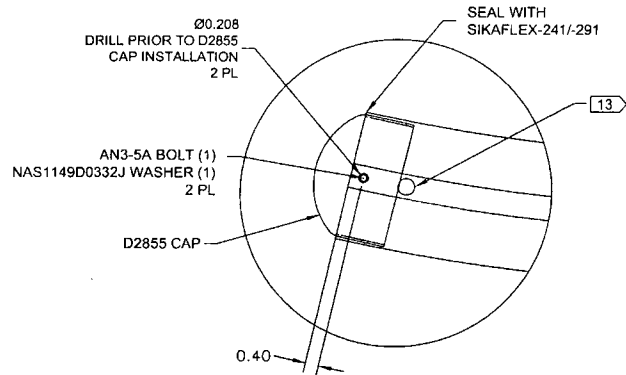


SECTION I-I SCALE 5X

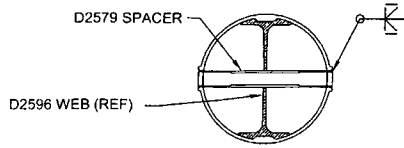

- AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
  2. INSERT D2579 SPACER (25 PLACES)
  3. WELD INTO PLACE AND GRIND FLUSH
  4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

DETAIL J SCALE 5X

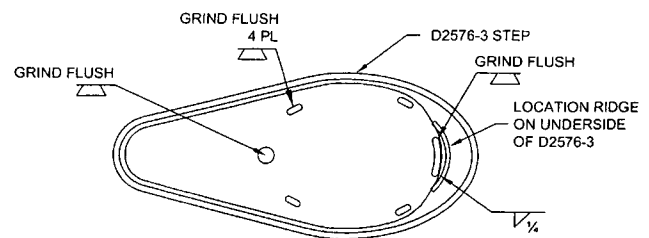

DEO ATTACHED  
RELEASED  
2011-08-29

DESIGN	#	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	10	DRAWING NO.	REV. E
MFG. APPR.	10	D2580	SHEET 6 OF 8
APPROVED	10	TITLE	SCALE
DE APPR.	#	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	COPYRIGHT © 1996 BY DART AEROSPACE LTD	
		THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_


Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



79713

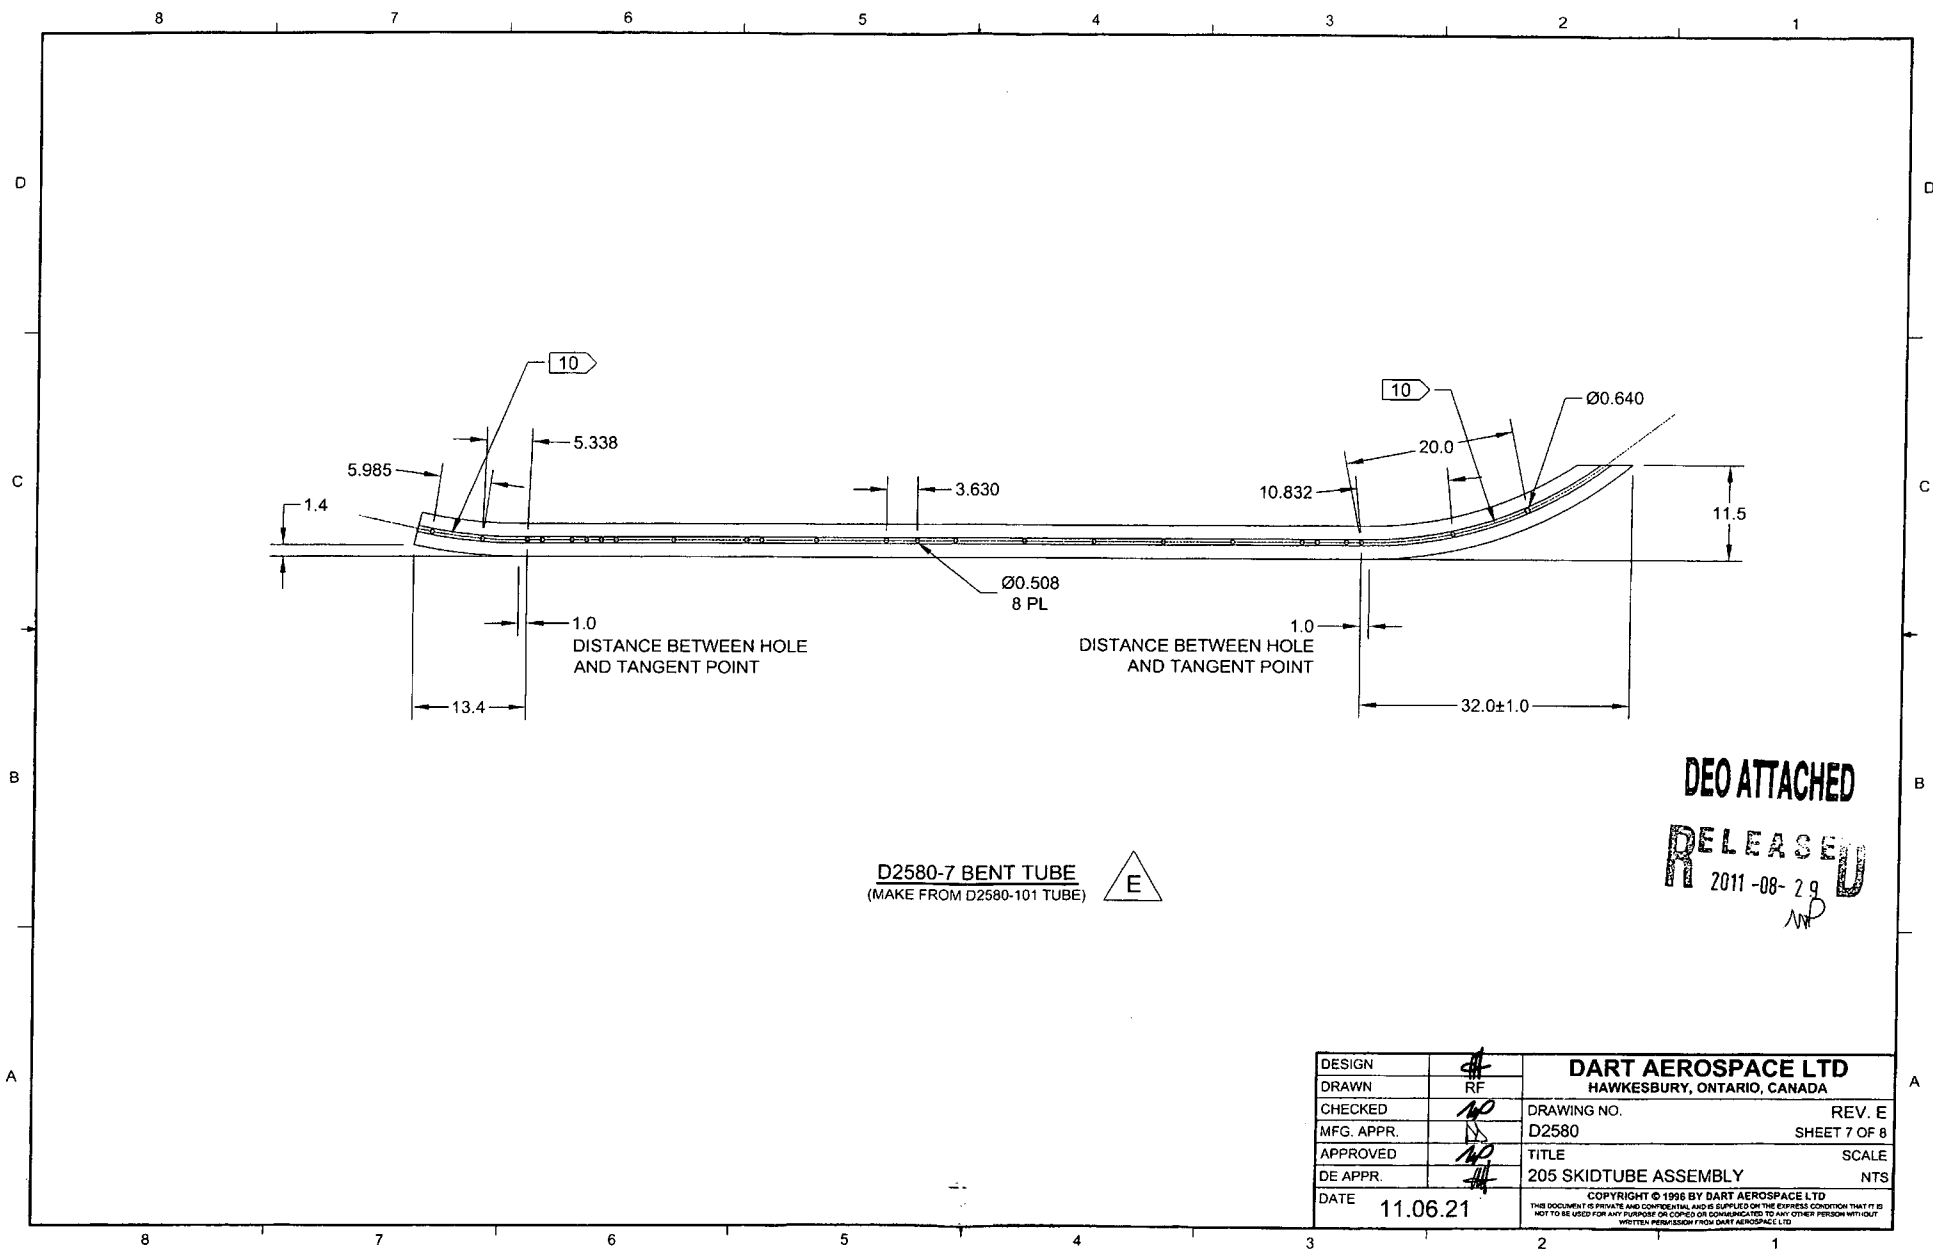

D2580-7 BENT TUBE  
(MAKE FROM D2580-101 TUBE) E

DEO ATTACHED  
RELEASED  
2011-08-29  
AM

DESIGN	#	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	10	DRAWING NO. D2580	REV. E
MFG. APPR.	10	TITLE	SHEET 7 OF 8
APPROVED	10	205 SKIDTUBE ASSEMBLY	SCALE
DE APPR.	10		NTS
DATE	11.06.21	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

79713

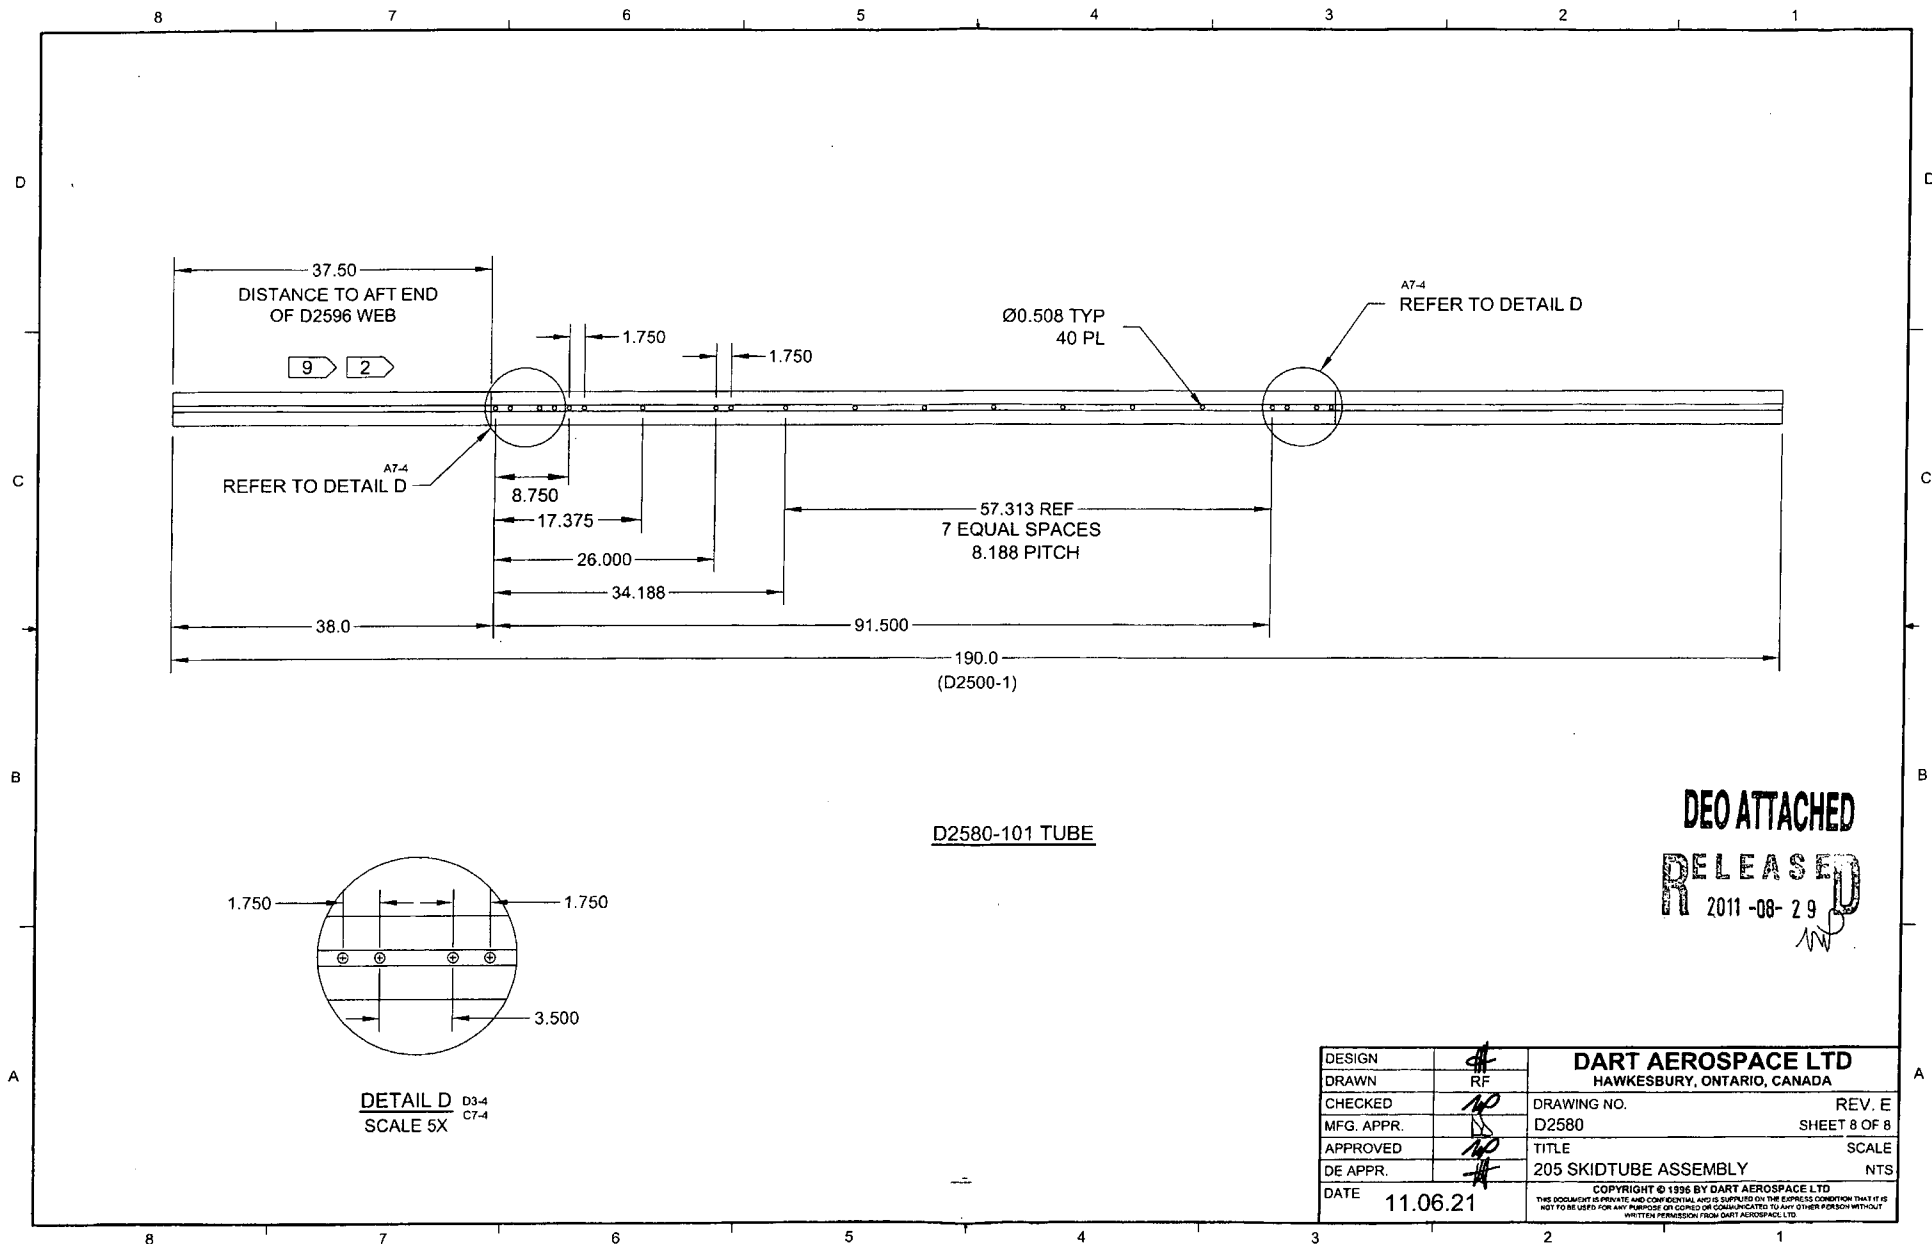

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

79713

DRAWING NO. D2580	TITLE 205 SKIDTUBE ASSEMBLY	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D2580-E-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>UP</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>ER</i>	APPROVED <i>[Signature]</i>		DE APPR. <i>[Signature]</i>		
DATE 11.12.13	DATE 11.12.13	DATE 11.12.13	DATE 11.12.13		DATE 11.12.13		

**PURPOSE:**

CHANGE ALL C'BORED WELDED CROSSBOLT SPACERS TO SWAGED SPACERS

**CHANGE:**

PARTS LIST IS AMENDED AS FOLLOWS:

**WAS**

QTY	QTY	QTY	PART NUMBER	DESCRIPTION
-041	-045	-047		
20	24	25	D2579	CROSS BOLT SPACER


**IS**

	4		* D2579	CROSS BOLT SPACER
20	20	25	D4202-1	SPACER

SECTION B-B, SECTION F-F, & SECTION I-I ARE AMENDED AS FOLLOWS  
FOR ALL HOLES THAT WERE ORIGINALLY C'BORED:

**\* FOR -045 SKIDTUBE ONLY:**  
WELD 4X D2579 SPACERS PER DWG  
IN LOCATIONS MARKED "NO C'BORE".  
REF SHEET 4 OF DWG.

RELEASED  
2011-12-14

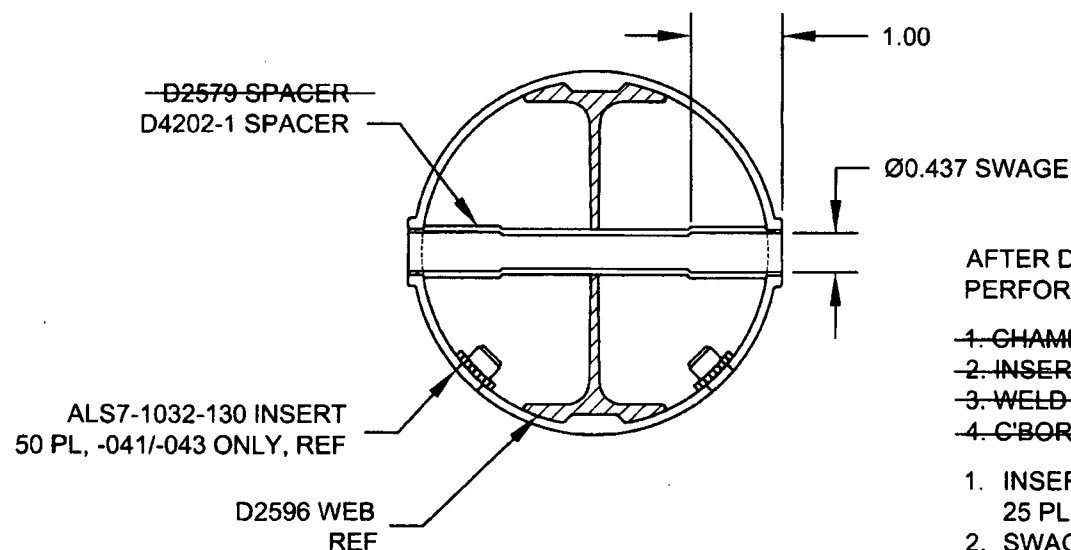

AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:

- ~~1. CHAMFER HOLE 0.050 X 45°~~
- ~~2. INSERT D2579 SPACER (20 PLACES)~~
- ~~3. WELD INTO PLACE AND GRIND FLUSH~~
- ~~4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP~~

1. INSERT D4202-1 SPACER, 20 PL (-041) OR 20 PL (-045) OR 25 PL (-047)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM / GRIND FLUSH PER QSI 002

**SECTION B-B, F-F, I-I**  
NOT TO SCALE

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries